


TROWELED BEAD OF DETAIL SEALANT PW OR LM-95 APPLIED TO TOP EDGE OF REPAIR PATCH AND TOOLED TO A FEATHERED EDGE - ADHESIVE OR SEALANT APPLICATION NOT REQUIRED

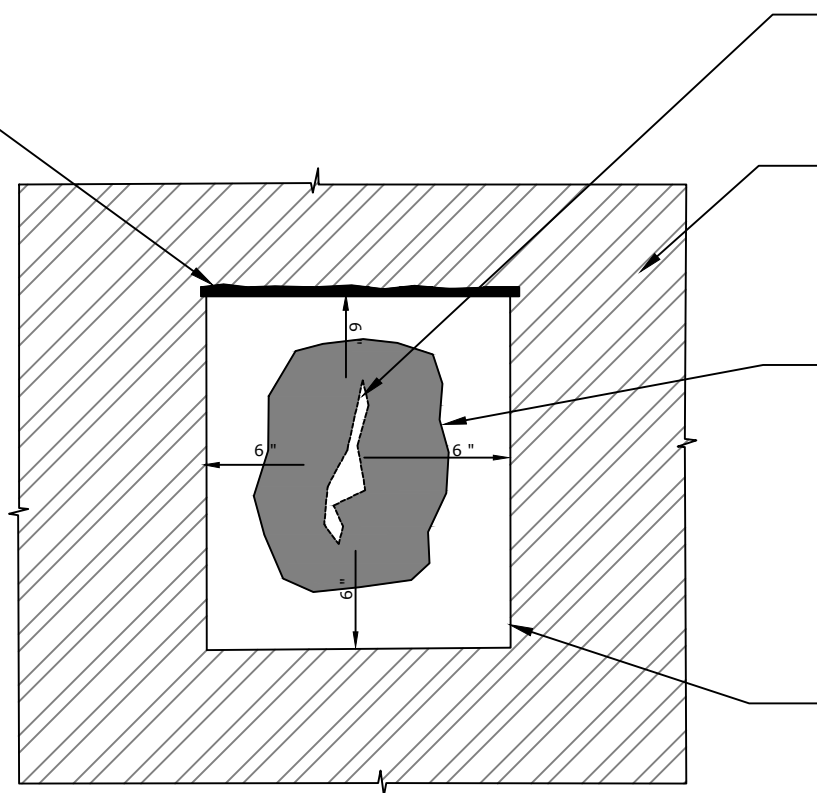

REPAIR AREA

BLINDSIDE MEMBRANE FABRIC FACING CONCRETE POUR

MINIMUM 60 MILS OF LM-95 COVERING THE DAMAGED AREA AND EXTENDING A MINIMUM OF 1" BEYOND DAMAGE IN ALL DIRECTIONS OVER FABRIC OF BLINDSIDE MEMBRANE PREPARED WITH 650 LT LIQUID ADHESIVE OR CALIFORNIA SEALANT AT A RATE OF 50 - 75 SF/GAL PRIOR TO LM-95

FABRIC TAPE APPLIED A MINIMUM OF 6" IN ALL DIRECTIONS PAST DAMAGE AND ONTO BLINDSIDE AND CURED LM-95 - PREPARE FABRIC OF BLINDSIDE WITH 650 LT LIQUID ADHESIVE OR CALIFORNIA SEALANT AT A RATE OF 50 - 75 SF/GAL

FRONT VIEW @ BLINDSIDE MEMBRANE REPAIR PATCH OVER DAMAGE LESS THAN 2"

BS8

© POLYGUARD PRODUCTS, INC.